For 4 Axes

Simple Controller



End to end

2-point operation is possible without programming!

Reduced setting labor Only the speed and force need to be set

Reduced wiring labor


Only 2 inputs/outputs*1

*1 Per axis

Space saving

63


86

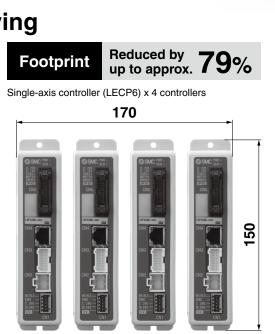








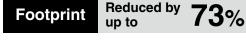


4-axis controller (JXC73/83/93)

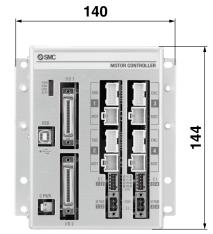






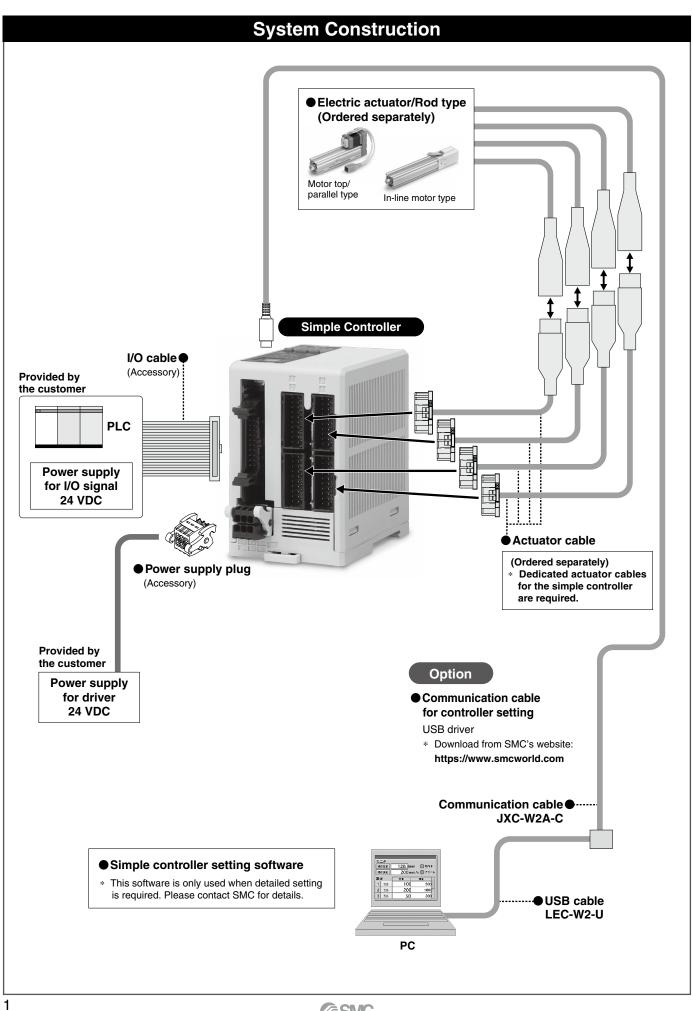

Specifications

Model	JXC□4-X1
Number of axes	4 axes
Compatible motor	Step motor (Servo/24 VDC) □42/□28/□20
Power supply	Power voltage: 24 VDC ±10%
Power consumption	Power consumption depends on the actuator size connected. Refer to the actuator specifications for further details.
Operating temperature range	0 to 55°C (No freezing)
Operating humidity range	90% or less (No condensation)
Insulation resistance	Between all external terminals and the case 50 M Ω (500 VDC)
Weight	300 g (DIN rail mounting), 390 g (Screw mounting)
Applicable actuator	LEY Series (Size 16, 25 * Excluding the LEYG)

Dimensions

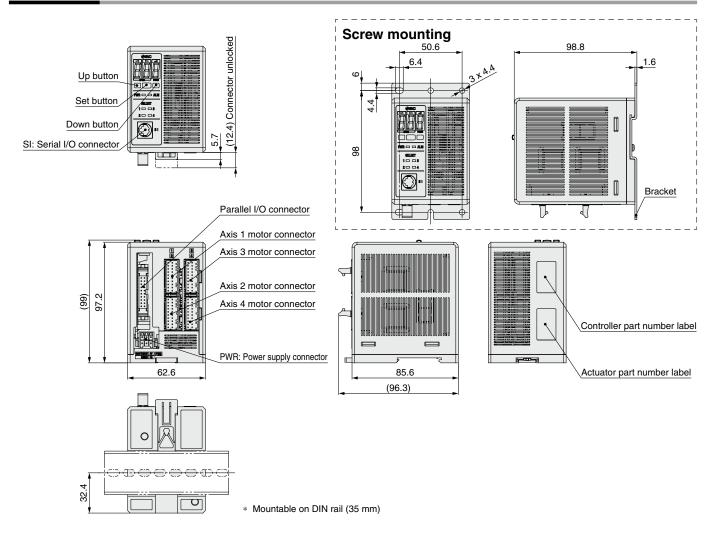

A Safety Instructions Be sure to read the "Handling Precautions for SMC Products" (M-E03-3) and "Operation Manual" before use.

SMC Corporation

Akihabara UDX 15F, 4-14-1, Sotokanda, Chiyoda-ku, Tokyo 101-0021, JAPAN Phone: 03-5207-8249 Fax: 03-5298-5362 https://www.smcworld.com © 2020 SMC Corporation All Rights Reserved